


Cut-Out

Panel cut-out

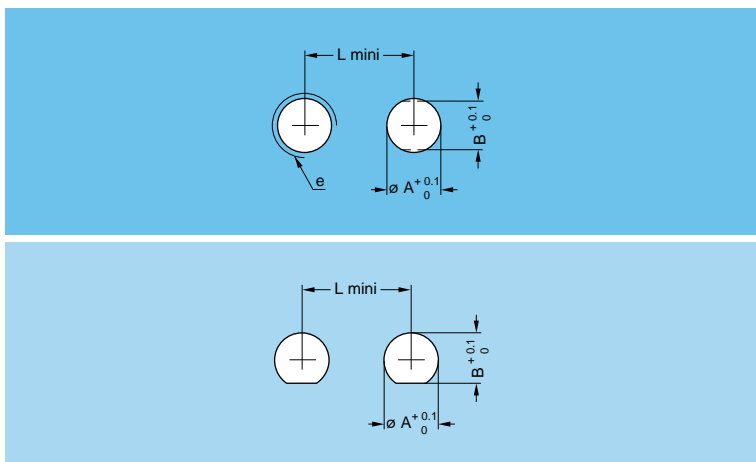


Note: 1) If these models are used with a tapered washer GBB, the panel cut-out must be according P1.

Recommended mounting nut torque: 2.5 Nm.

Cut-out	Model	Dimensions			
		A	B	L	e
P1	HGP-HGW-SWH-ECP EPE-EPS-FAB-EWF	7.1	–	14.5	–
P2	EWV	–	–	12.0	M7x0.5
P3	ERC	–	–	9.0	M7x0.5
P4	ERT	7 ⁰ _{-0.02}	–	–	–
P5	Other models ¹⁾	7.1	6.5	14.5	–
P6	ABB	9.7	9.0	15.0	–
P7	ABD	12.9	11.7	20.5	–
P8	ANC	16.1	13.7	24.0	–

PCB drilling pattern

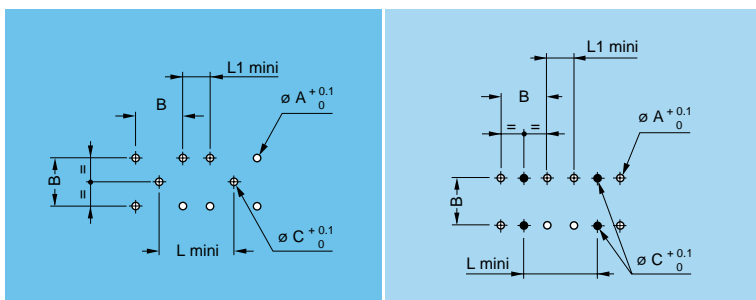

Cut-out	Model	Dimensions				
		A	B	L	L1	C
P9	EPN	0.9	5.08	–	2.0	–
P10	Other models	0.8	5.08	8.0	2.9	0.8
P11	FPA	0.8	5.08	8.0	2.9	1.0
P12	EPE-EPS	0.8	5.08	14.5	9.4	0.8
P13	EPY	0.8	5.08	9.0	3.9	0.8